


Welding Male

RACCORDO FEMMINA A SALDARE

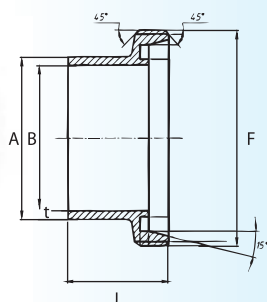


DN	F	A	B	J	t
mm	mm	mm	mm	mm	mm
10	27,6	12	9	21	1,5
15	33,6	18	15	21	1,5
20	43,5	22	19	24	1,5
25	51,5	28	25	29	1,5
32	57,3	34	31	32	1,5
40	64,5	40	37	33	1,5
50	77,5	52	49	35	1,5
60	84,5	61	57	36	2
65	94,5	70	66	40	2
80	109,5	85	81	45	2
100	129,5	104	100	54	2
125	159,3	129	125	46	2
150	189,3	154	150	50	2

1

Welding Liner

RACCORDO MASCHIO A SALDARE

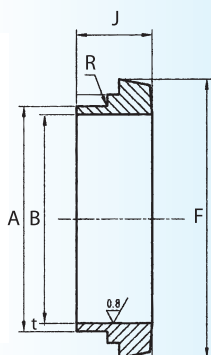


DN	A	B	F	J	t
mm	mm	mm	mm	mm	mm
10	12	9	22	17	1,5
15	18	15	28	17	1,5
20	22	19	36	18	1,5
25	28	25	44	22	1,5
32	34	31	50	25	1,5
40	40	37	56	26	1,5
50	52	49	68	28	1,5
60	61	57	76	30	2
65	70	66	86	32	2
80	85	81	100	37	2
100	104	100	121	44	2
125	129	125	150	34	2
150	154	150	176	37	2

2

Nut

GIRELLA

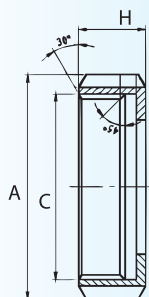

DN	C	A	H
mm	mm	mm	mm
10	28 x 1/8	38	18
15	34 x 1/8	44	18
20	44 x 1/6	54	21
25	52 x 1/6	63	21
32	58 x 1/6	70	21
40	65 x 1/6	78	21
50	78 x 1/6	92	22
60	85 x 1/6	99	22
65	95 x 1/6	112	25
80	110 x 1/4	127	30
100	130 x 1/4	148	31
125	160 x 1/4	178	35
150	190 x 1/4	210	40

3